

Article No.
98-25-13

**POWER WINDOWS—POWER WINDOWS MAY NOT
OPERATE—VEHICLES BUILT THROUGH 1/31/1998**

FORD: 1996-98 TAURUS

LINCOLN-MERCURY: 1996-98 SABLE

ISSUE

Some vehicles built prior to 1/31/1998 may exhibit an inoperative power window. This may be caused by contaminants on the window and glass run weatherstrip. In addition, hot weather and infrequent use of the power window aggravates the condition.

ACTION

Replace the window motor and lubricate the glass-run weatherstrip with Silicone Lubricant Spray. The new window motor is more efficient and lubricating the glass run weatherstrip decreases the window-to-seal breakaway effort. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Verify window will not operate by holding power window switch for 5 seconds.
2. Remove power window motor per appropriate Taurus/Sable Service Manual and install new motor.
3. Lubricate the glass run weatherstrip with Silicone Lubricant Spray (F5AZ-19553-AA, or equivalent).
4. Verify smooth window operation.

PART NUMBER	PART NAME
F8DZ-5423395-AA	Motor - RH
F8DZ-5423394-AA	Motor - LH
F5AZ-19553-AA	Silicone Lubricant Spray

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The
Provisions Of Bumper To
Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
982513AB	Replace Window Motor And Lubricate Glass Run Weatherstrip - Both Front Doors	1.1 Hr.
982513AC	Replace Window Motor And Lubricate Glass Run Weatherstrip - One Rear Door	0.5 Hr.

982513AD	Replace Window Motor And Lubricate Glass Run Weatherstrip - Both Rear Doors	0.8 Hr.
982513AE	Replace Window Motor And Lubricate Glass Run Weatherstrip - All Doors	1.7 Hr.
982513A	Replace Window Motor And Lubricate Glass Run Weatherstrip - One Front Door	0.7 Hr.

DEALER CODING

BASIC PART NO.
5423394, 5423395
OASIS CODES: 102000

**CONDITION
CODE**
41

Index : 050756